

28 Assemble Needle Bearing with vendor I.D. facing the Gear.


37 Assemble Ball Bearing with seal towards Pinion and shield towards Armature.

MILWAUKEE ELECTRIC TOOL CORPORATION

13135 W. LISBON RD., BROOKFIELD, WI 53005 Drwg. 3


INSTALLING BRUSH SPRINGS ON A BRUSH CARD ASSEMBLY WITH FOUR (4) BRUSHES

There are two 40-50-2170 RH Brush Springs and two 40-50-2175 LH Brush Springs. Follow the instructions below for proper installation.

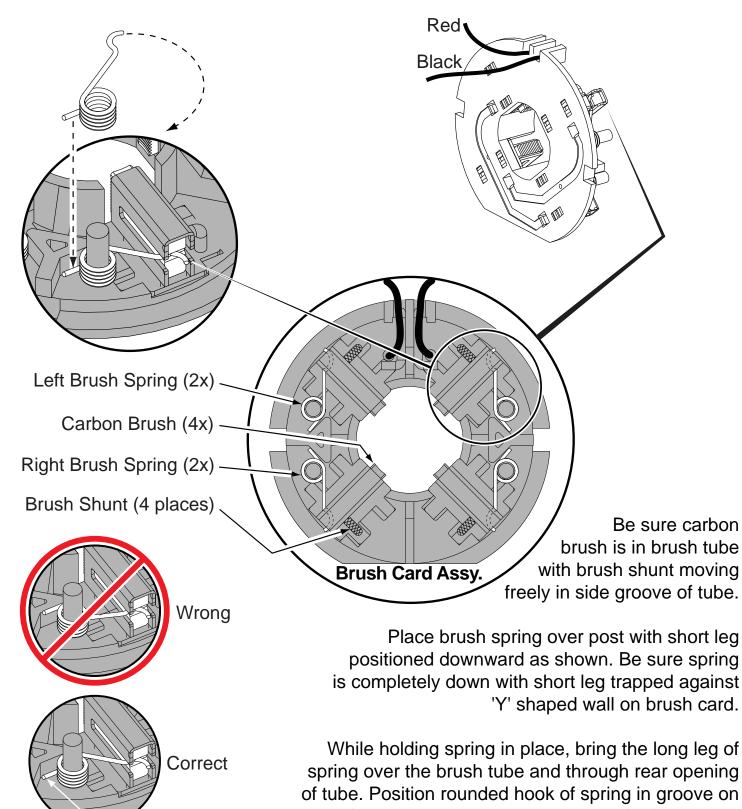

Short leg of spring to the bottom

back of carbon brush. Be sure to check for free movement between carbon brush, brush shunt and brush spring.

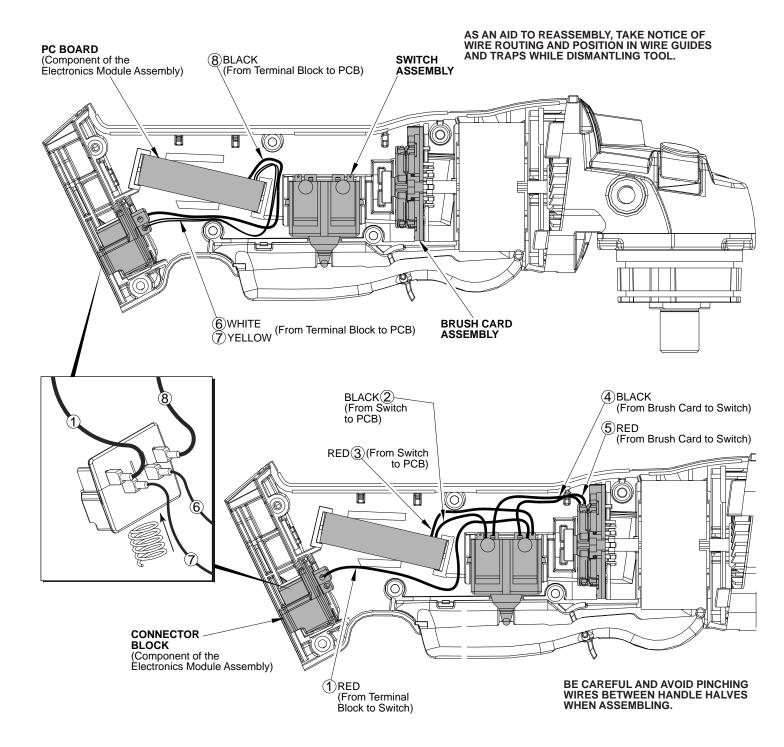

WIRING SPECIFICATIONS					
Wire No.	Wire Color	Origin or Gauge	Length	Terminals, Connectors and 1 or 2 End Wire Preparation	
1	Red	14		Component of the Electronics Module Assembly.	OB
2	Black	14		Component of the Electronics Module Assembly.	
3	Red	18		Component of the Electronics Module Assembly.	
4	Black	15		Component of the Brush Card Assembly.	
5	Red	15		Component of the Brush Card Assembly.	
6	White	24		Component of the Electronics Module Assembly.	
7	Yellow	24		Component of the Electronics Module Assembly.	
8	Black	14		Component of the Electronics Module Assembly.	
		BUI	K LEAD W	IRE - BULLETIN NO. 58-01-0003	

