How to Order CBC-LOK®/CS-LOK®

CBC-Lok®/CS-Lok® Tube Fittings are ordered as listed in this catalog by inserting the material code before the part number. CBC-Lok®/CS-Lok® Tube Fittings can be identified through the part number as to material, tube size, configuration, and thread connection. The part number describes a complete fitting assembly.

Special Configurations available upon request.

Example: A Stainless Steel Female Run Tee, 3/8" Tube Size to 1/4" Female Pipe to 3/8" Tube is designated as follows:




CHART 1- MATERIAL					
В	Brass				
SS	Stainless Steel				
S	Steel				

CHART 3- STYLE					
D	CBC-Lok®				
S	CS-Lok®				

CHART 2- SIZES							
Fractional (inches)					Metric (millimeters)		
DESIGNATOR	TUBE OR HOSE O.D	PIPE THREAD (NPT)	AN/STB TUBE SIZE	PIPE THREAD BSPP/BSPT	DESIGNATOR	TUBE O.D	
1	1/16	1/16-27		1/16-28	6	6 mm	
2	1/8	1/8-27	5/16-24	1/8-28	8	8 mm	
3	3/16				10	10 mm	
4	1/4	1/4-18	7/16-20	1/4-19	12	12 mm	
5	5/16				18	18 mm	
6	3/8	3/8-18	9/16-18	3/8-19			
8	1/2	1/2-14	3/4-16	1/2-14			
10	5/8						
12	3/4	3/4-14	1-1/16-12	3/4-14			
14	7/8						
16	1	1-11 1/2	1-5/16-12	1-11			

CHART 4- DESCRIPTION					
ATANF	Adapter Tube to AN Flare				
ATPF	Adapter Tube to Female Pipe				
ATPM	Adapter Tube to Male Pipe				
BHA	Bulkhead Adapter				
BHFP	Bulkhead Female Pipe Connector				
BHMP	Bulkhead Male Pipe Connector				
BHU	Bulkhead Union				
BUANF	Bulkhead to AN Flare Union				
CAP	Сар				
F PLUG	Fitting Plug				
FC	Female Connector				
MC	Male Connector				
PCU	Port Connector Union				
RATT	Reducer Adapter Tube to Tube				
RPC	Reducing Port Connector				
DRU	Reducing Union				
TBW	Tube to Butt Weld Connector				


CHART 5- MODIFIERS						
BBT	Branch Bored Through					
BT	Bored Through					
BSPT	BSPT Male Connector					
CL	Cleaned & Lubricated to ASTM G93 Level C					
SPCL	Cleaned & Lubricated to CGA G-4.1-2009					
ORF-###	Orifice Fittings (### designates orifice size)					
ORS	O-Ring Straight Thread Male Connector					
ORT	O-Ring Tapered Thread Male Connector					
RS	BSPP Male Connector					
STB	Straight Thread Boss Male Connector					

CHART 4- DESCRIPTION						
TSW	Tube to Socket Weld Connector					
U	Union					
UANF	Tube to AN Flare Union					
ELU	Union Elbow					
ELU45	Union 45° Elbow					
FE	Female Elbow					
ME	Male Elbow					
ME45	Male 45° Elbow					
TBWE	Tube to Butt Weld Elbow					
TSWE	Tube to Socket Weld Elbow					
TFT	Female Run Tee					
TMT	Male Run Tee					
TTF	Female Branch Tee					
TTM	Male Branch Tee					
TTT	Union Tee					
CR	Union Cross					
N	Nut					
KN	Knurled Nut					

DU/SU Union





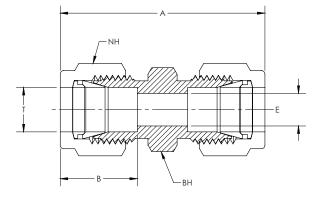

CBC PART NUMBER	INTERCH Wi		CS PART NUMBER	INTERCHANGES WITH	T TUBE O.D.	Α	В	E THRU HOLE	NH NUT HEX	BH BODY HEX
1-DU	100-6	1SC1	1-SU	1-1 HBZ	1/16	1.00	0.34	0.05	5/16	5/16
2-DU	200-6	2SC2	2-SU	2-2 HBZ	1/8	1.41	0.52	0.09	7/16	7/16
3-DU	300-6	3SC3	3-SU	3-3 HBZ	3/16	1.47	0.54	0.13	1/2	7/16
4-DU	400-6	4SC4	4-SU	4-4 HBZ	1/4	1.61	0.61	0.19	9/16	1/2
5-DU	500-6	5SC5	5-SU	5-5 HBZ	5/16	1.72	0.65	0.25	5/8	9/16
6-DU	600-6	6SC6	6-SU	6-6 HBZ	3/8	1.78	0.67	0.28	11/16	5/8
8-DU	810-6	8SC8	8-SU	8-8 HBZ	1/2	2.02	0.90	0.41	7/8	13/16
10-DU	1010-6	10SC10	10-SU	10-10 HBZ	5/8	2.04	0.96	0.50	1	15/16
12-DU	1210-6	12SC12	12-SU	12-12 HBZ	3/4	2.11	0.96	0.63	1-1/8	1-1/16
14-DU	1410-6	14SC14	14-SU	14-14 HBZ	7/8	2.17	1.02	0.72	1-1/4	1-3/16
16-DU	1610-6	16SC16	16-SU	16-16 HBZ	1	2.58	1.24	0.88	1-1/2	1-3/8

NOTE: Dimensions subject to change, to be used for reference only.