




4515 East 139th Street
 Grandview, MO 64030
 (800) 362-9055
 Fax (800) 362-1463
 www.PRIER.com

408 Series Freezeless Wall Hydrant

Application

Internal Vacuum Breaker

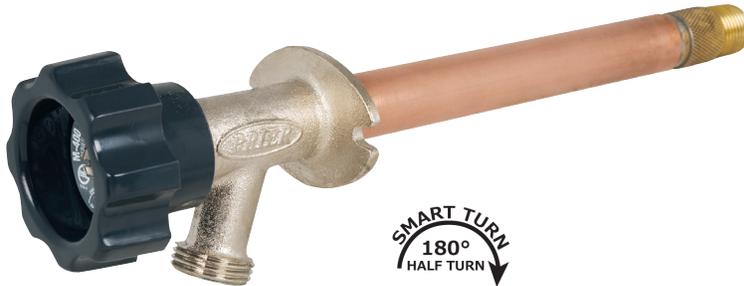

- Residential
- Freezeless
- Anti-Siphon
- Backflow Check Valve



PRIER 408 Series provides a year round source of water to areas of structures that are subject to freezing temperatures. The hydrant valve is connected to the supply piping in the heated portion of the structure, eliminating the possibility of freezing. The PRIER 408 Series features the half-turn design for years of easy operation.

The PRIER 408 Series has all the characteristics of the historically proven 300 Series Wall Hydrant, with the added protection of an integral vacuum breaker and backflow preventor. PRIER's design incorporates the vacuum breaker and backflow preventor into the operating stem, eliminating an external vacuum breaker on top of the valve.

Features

- ASSE 1019 and C-UPC approved
- Internal vacuum breaker and backflow preventor
- Easy half-turn operation
- Integral cast backflange
- Wide screw holes easily secure mounting screws
- Siding wedge included with each valve
- Solid brass body and seat
- Satin nickel plated body maintains finish indefinitely
- Easy grip polycarbonate operating handle
- Stainless steel handle Screw
- Full circle seat threads secure stem to seat end
- AFG teflon and graphite packing for easy maintenance
- Each valve air-tested at factory for leak free quality
- Spout aligning mark

Inlet Styles



D Style
1/2" MIP x 1/2" SWT



X Style
1/2" Crimp PEX



T Style
3/4" MIP x 1/2" FIP



F Style
3/4" MIP x 3/4" SWT



W Style
1/2" Uponor PEX

Ordering

408-10

Inlet

- 08-D- 1/2" MPT x 1/2" SWT
- 09-T- 3/4" MPT x 1/2" FPT
- 12-F- 3/4" MPT x 3/4" SWT
- 20-X- 1/2" Crimp PEX
- 21-W- 1/2" Uponor PEX


Length

- CC- Close Coupled
- 04- 4" Insertion
- 06- 6" Insertion
- 08- 8" Insertion
- 10- 10" Insertion
- 12- 12" Insertion
- 14- 14" Insertion



4515 East 139th Street
 Grandview, MO 64030
 (800) 362-9055
 Fax (800) 362-1463
 www.PRIER.com

Replacement Parts

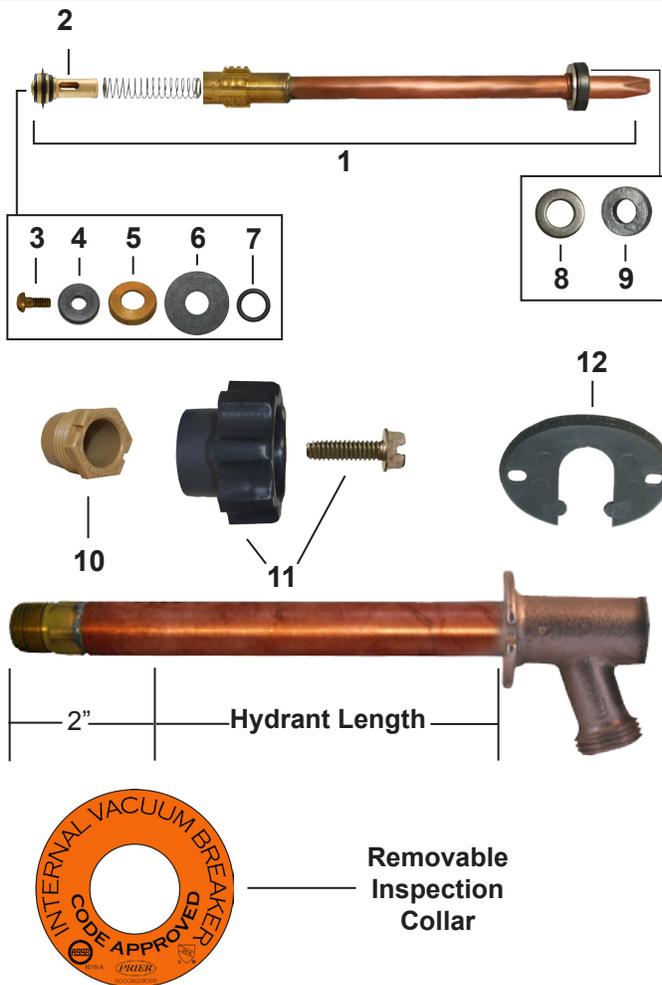

ID	Part No.	Description
1	See Below	Stem Assembly Contains: 1, 2, 3, 4, 5, 6, 7, 8, 9
2	231-3201	BFP Assembly
3	910-3008	Bibb Screw (Brass)
4	936-3012	Bibb Washer (Rubber)
5	310-3016	Cage Washer (Brass)
6	936-3011	BFP Washer (Rubber)
7	936-3002	Stem End O-Ring (Rubber)
8	324-1006	Washer (Stainless Steel)
9	339-3002	Packing for Left Hand Packing Nut (Graphite)
10	337-3001	Left Hand Thread Packing Nut (Plastic)
11	630-7965	Handle & Screw Kit (Grey Plastic Handle & Stainless Steel Screw)
	630-7965	Handle & Screw Kit (Beige Plastic Handle & Stainless Steel Screw)
12	337-3012	Space Wedge (Grey, Plastic)
	337-3013	Space Wedge (Beige, Plastic)
	630-7755	Service Kit for 300/400/500 Series Contains: 3, 4, 5, 6, 7, 8, 9, 10

*The 630-7755 Wall Hydrant Repair Kit includes parts for the 300, 400 and 500 Series hydrants, some of which are not pictured here. When repairing a hydrant you will have parts left over.

Replacement Stems



Part No.	Description	Stem Length
M-123-4090	Stem for 4" 400 Series Hydrant	8" OAL
M-123-4092	Stem for 6 " 400 Series Hydrant	10" OAL
M-123-4093	Stem for 8" 400 Series Hydrant	12" OAL
M-123-4094	Stem for 10" 400 Series Hydrant	14" OAL
M-123-4095	Stem for 12" 400 Series Hydrant	16" OAL
M-123-4096	Stem for 14" 400 Series Hydrant	18" OAL

**400 Series stems are made to fit the 400, 408 and 400-LF Series Wall Hydrants only. They are not interchangeable with any other models. For parts for Mansfield style anti-siphon hydrants made prior to 2007, see the retired 500 Series spec sheet.