



McGuire Manufacturing Co., Inc.

60 Grandview Court
 Cheshire, Connecticut 06410
 (203) 699-1801 Fax (203) 699-1813
 customerservice@mcguiremfg.com mcguiremfg.com


Part No.
8088, 8089, 8089CNC,
8090, 8090CNC, 1207, 1208

Cast P-Trap Ground Joint
Swivel With Or
Without Cleanout

PRODUCT SPECIFICATION

Job Name:

Submittal Number:

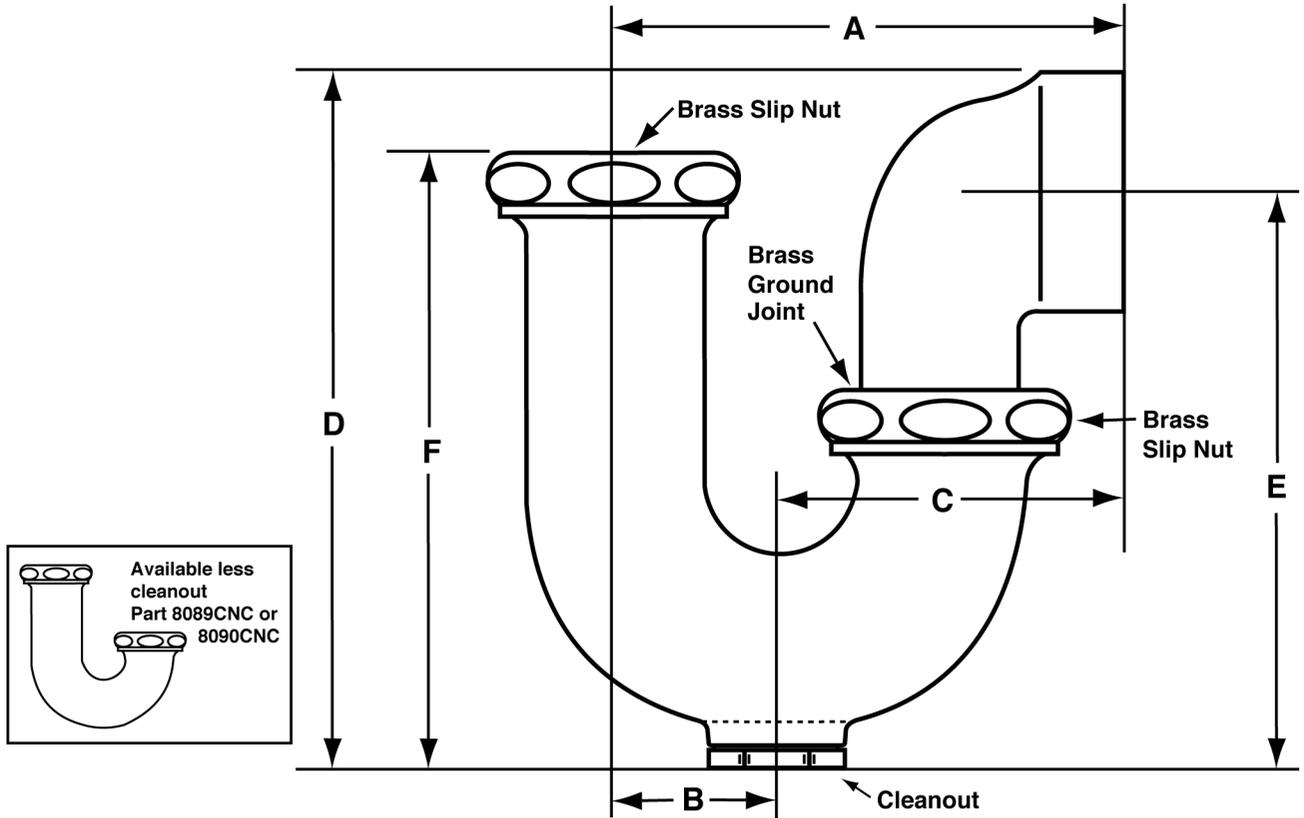

ROUGHING MEASUREMENTS

NO.	TRAP DIMENSIONS		A	B	C	D	E	F
	INLET	OUTLET						
8088	1-1/4" x 1-1/4"	IPS 1-1/4"	4-3/16"	1-1/4"	2-15/16"	5-1/2"	4-1/2"	5"
8089	1-1/2" x 1-1/2"	IPS 1-1/2"	4-1/4"	1-3/8"	2-7/8"	5-3/4"	4-5/8"	5"
8089CNC	1-1/2" x 1-1/2"	IPS 1-1/2"	4-1/4"	1-3/8"	2-7/8"	5-3/8"	4-1/4"	4-5/8"
8090	1-1/4" x 1-1/2"	IPS 1-1/2"	4-1/4"	1-3/8"	2-7/8"	5-3/4"	4-5/8"	5"
8090CNC	1-1/4" x 1-1/2"	IPS 1-1/2"	4-1/4"	1-3/8"	2-7/8"	5-3/8"	4-1/4"	4-5/8"
1207	1-1/2"	IPS 2"	5-3/8"	1-3/4"	3-5/8"	6-5/8"	5-1/4"	5-1/16"
1208	2"	IPS 2"	5-3/8"	1-3/4"	3-5/8"	6-5/8"	5-1/4"	5-1/16"

FED SPEC W.W.P. 541
CAST BRASS P-TRAP
MINIMUM SEAL 2"

See options and accessories section for details on product variations.

ASME A112.18.2/CSA B125.2



Specifications:

P-Trap shall be chrome plated cast brass body (with, without) cleanout, cast brass ground joint elbow and cast brass slip nut. No reducing washers. With (shallow, deep, bell) (steel, brass) or (forged brass with set screw) flange. P-Trap shall be McGuire (8088, 8089, 8090, 1207, 1208). Trap shall be certified by CSA or other recognized testing authority. P-Trap shall bear manufacturer and testing mark.



WARNING:

This product can expose you to chemicals including lead, which is known to the State of California to cause cancer, and birth defects or other reproductive harm. For more information go to www.P65Warnings.ca.gov.