


## C-144/244 REPLACEMENT PARTS

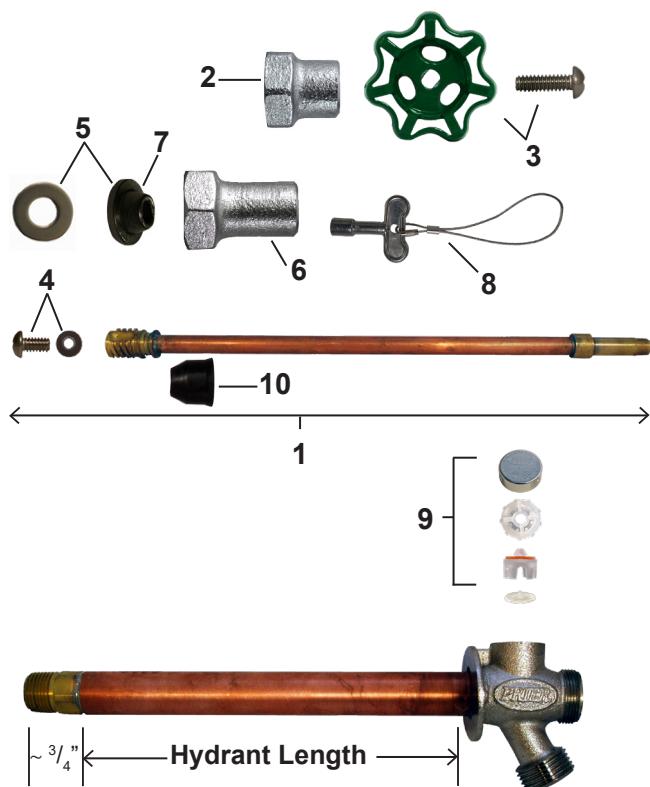

ID	Part No.	Description
1	See Replacement Stem Section	Stem Assembly, Contains: 1, 4, 10
2	300-1008	Valve Stem Cap
3	C-134KT-805	Oval Handle and Screw Kit
4	C-134KT-802	Seat Washer Replacement Kit (00 Beveled)
5	C-134KT-803	Stem Packing Replacement Kit
6	310-1015	Valve Stem Cap for Loose Key
7	390-1001	Stem Packing Only
8	C-108KT-808	Oval Style Key on Lanyard
9	C-144KT-806	Universal Vacuum Breaker Replacement Kit
10	336-0002	Backflow Check Valve for C-144
	C-134KT-804	Handle to Loose Key Conversion Kit Contains: 5,6,8
	C-234KT-804	Loose Key to Handle Conversion Kit Contains: 2, 3, 5
	C-144KT-807	C-144 Overhaul Kit Contains: 3, 4, 5, 9, 10

\*The C-144KT-806 Universal Vacuum Breaker Kit fits all current and past PRIER and Mansfield style residential hydrants.

## REPLACEMENT STEMS



**G Style Manufactured April 2013 - Present**

Part No.	Style	Stem Length	Description
310-0063	G	3 1/4" OAL	Super Close Coupled Stem for C-144 Hydrant
P-231-12CC	G	4 3/8" OAL	Close Coupled Stem for C-144 Hydrant
P-231-1204	G	6 7/8" OAL	Stem for C-144 Hydrant
P-231-1206	G	8 7/8" OAL	Stem for C-144 Hydrant
P-231-1208	G	10 7/8" OAL	Stem for C-144 Hydrant
P-231-1210	G	12 7/8" OAL	Stem for C-144 Hydrant
P-231-1212	G	14 7/8" OAL	Stem for C-144 Hydrant
P-231-1214	G	16 7/8" OAL	Stem for C-144 Hydrant
P-231-1216	G	18 7/8" OAL	Stem for C-144 Hydrant
P-231-1218	G	20 7/8" OAL	Stem for C-144 Hydrant
P-231-1220	G	22 7/8" OAL	Stem for C-144 Hydrant
P-231-1222	G	24 7/8" OAL	Stem for C-144 Hydrant
P-231-1224	G	26 7/8" OAL	Stem for C-144 Hydrant
P-231-12US	G	Up to 16 7/8" OAL	*Universal Replacement Stem for C-144 Hydrant

\*\*For stems manufactured before 2013, see C-144 Series retired style spec sheet at [PRIER.com](http://PRIER.com). PRIER universal stems are replacement stems for any size from 4" to 14." The P-231-12US Universal Stem requires cutting the rod to proper length and soldering the brass stem end to the rod as directed in instructions.

**4515 E. 139th Street Grandview, MO 64030 | (800) 362-9055 | [PRIER.com](http://PRIER.com)**

\*Per ASSE 1019 Code, do not leave on for more than 12 continuous hours.

C-144-Q