


NOTES:

1. TO INSPECT ASSEMBLY, FOLLOW FIRST ARTICLE AND IN PROCESS INSPECTION SHEET.


2. APPLY THIN COAT OF SILICON GREASE ON TO ALL O' RINGS BEFORE INSTALLATION.

3. APPLY PERMANENT THREAD LOCKER (LOCTITE 680).

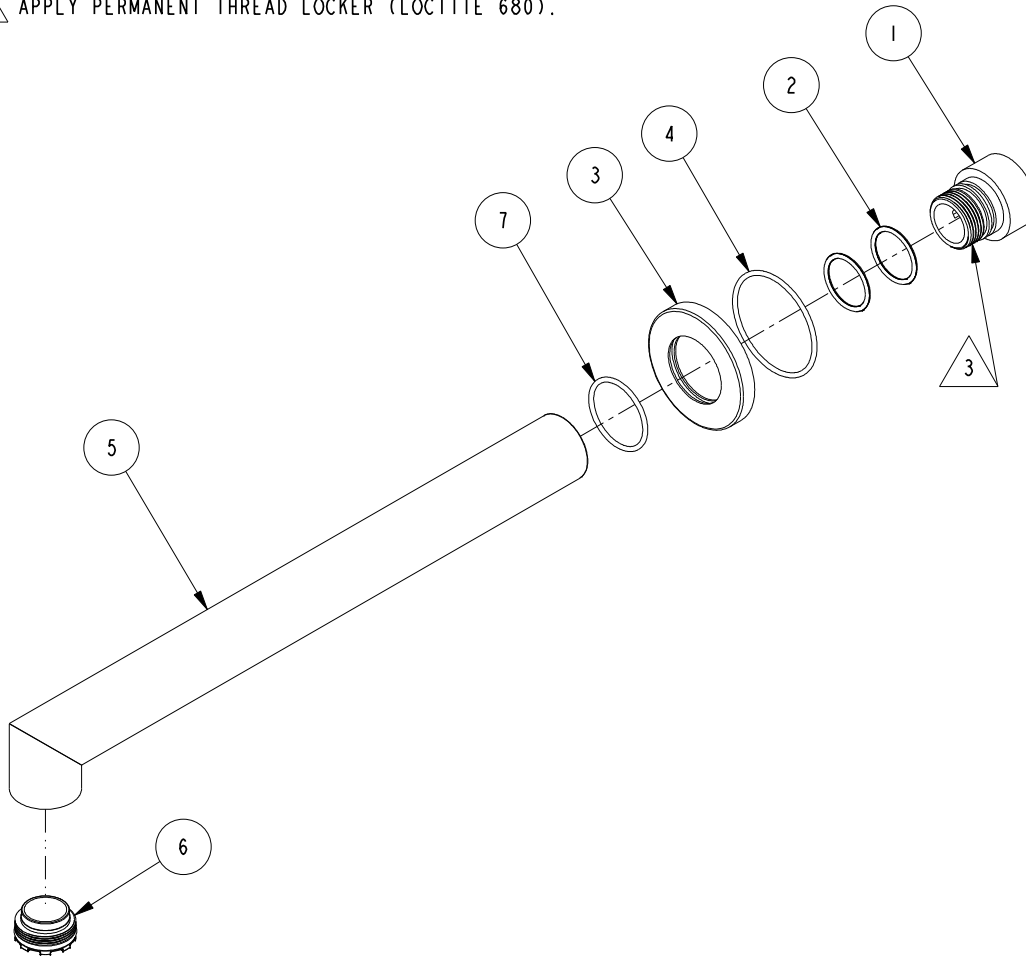

BILL OF MATERIAL (CURRENT LEVEL)

ITEM	PT/ASSY	DESCRIPTION	TYPE	QTY.
1	11894	WALL MOUNT TUB - ADAPTER	PART	1
2	91022	O-RING, #2- 018, EPDM, 65-75 DURO, NSF 61	PART	2
3	12285	W/M TUB- ESCUTCHEON	PART	1
4	91766	O-RING, #2-029, 50 DURO	PART	1
5	20-307	W/M TUB - SPOUT BRAZE ASM	ASSEMBLY	1
6	11711	HIDDEN FAUCET AERATOR	PART	1
7	91024	O-RING, #2- 022, EPDM, 65-75 DURO	PART	1

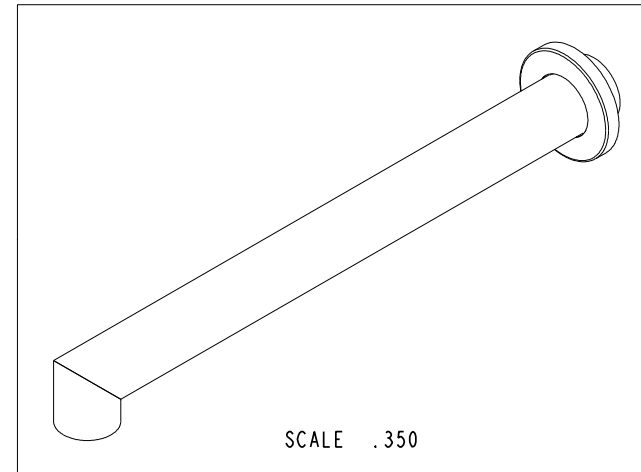


-	C	EN-4300ii	01/25/21	R.S.
-	B	EN-3722	02/08/19	C.G.
-	A	EN-3503	12/19/17	J.M.
-	-	EN-3408	09/22/17	J.M.
ZONE	REV	DESCRIPTION	DATE	APPROVED

COPYRIGHT 2005 BRASSTECH, INC. THESE DRAWINGS AND THE DESIGNS DEPICTED HEREIN ARE THE PROPRIETARY PROPERTY OF BRASSTECH. ANY USE OR REPRODUCTION IS SUBJECT TO THE EXPRESS APPROVAL OF BRASSTECH. UNAUTHORIZED USE IS STRICTLY PROHIBITED. ALL RIGHTS RESERVED.

		-	-
TESTING	-	-	-
ASSEMBLY	-	-	-
PLATING	-	-	-
POLISHING	-	NEXT ASSY	USED ON
MACHINING	-	APPLICATION	
TOOLING FIXTURE #		REMOVE ALL BURRS AND SHARP EDGES	

UNITS ARE: INCHES [MM]		
TOLERANCES ARE:		
FRACTIONS	DECIMALS	ANGLES
±1/16"	.X ±.1 [2.5]	±1°
	.XX ±.06 [1.5]	
(X.XXX) DENOTES CRITICAL DIMS.		
ALL THREADS ARE CRITICAL		
DRAWN	JINSON	02/08/19
CHECKED	C.G.	02/08/19
APPROVED	C.G.	02/08/19

BRASSTECH		2001 CARNEGIE AVE. SANTA ANA, CA 92705 (949) 417-5207	
INCORPORATED			
SPOUT & ESCUTCHEON ASM - WALL MOUNT TUB			
DWG NO. 3-614			REV C
SCALE .375	REF. -	SHEET 1	OF 2

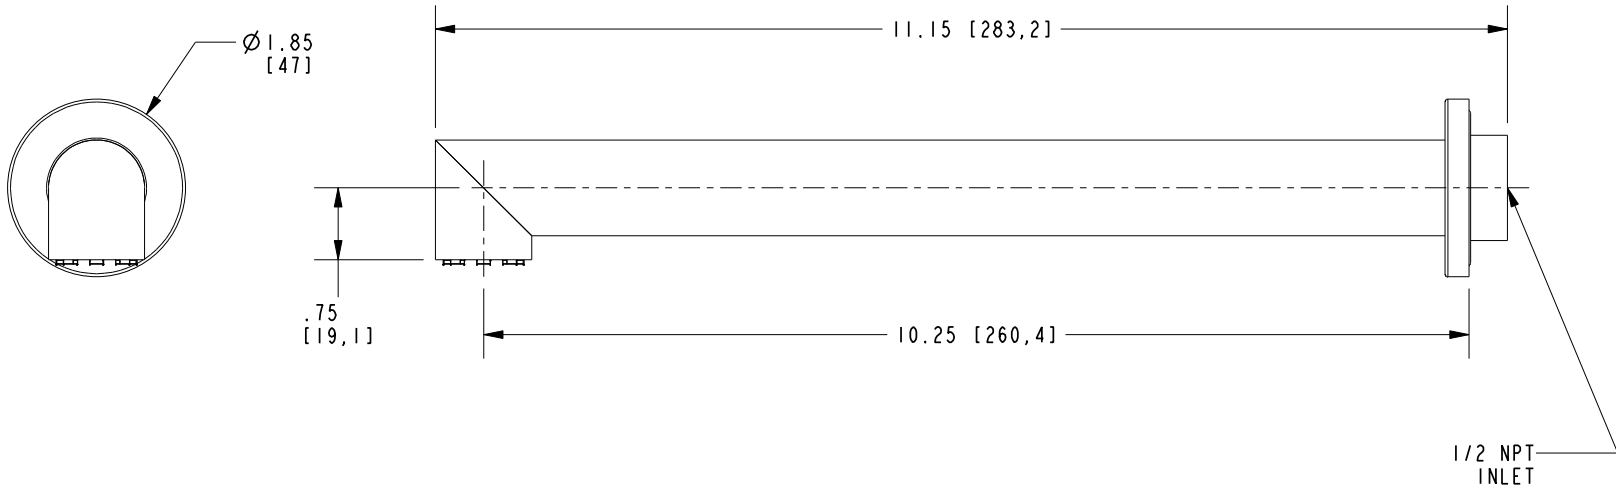

BRASSTECH		2001 CARNEGIE AVE. SANTA ANA, CA 92705 (949) 417-5207	
INCORPORATED			
DWG NO.	3-614		REV C
SCALE	.500	REF.	-
		SHEET	2 OF 2